

**SINGLE SURVEY, ENERGY
PERFORMANCE CERTIFICATE AND
GENERAL MORTGAGE VALUATION
REPORT**

**63 Whitson Road
Edinburgh
EH11 3BU**



FIRST SURVEYORS SCOTLAND
National Valuations & Property Consultancy Service



single survey

Member Firm of
FIRST SURVEYORS SCOTLAND
National Valuation & Property Consultancy Service

Survey report on:

Property address	63 Whitson Road Edinburgh EH11 3BU
-------------------------	--

Customer	Mrs L MacDonald
-----------------	-----------------

Customer address	63 Whitson Road Edinburgh EH11 3BU
-------------------------	--

Date of Inspection	1 st August 2011
---------------------------	-----------------------------

Prepared by	David Adamson & Partners Limited <i>Chartered Surveyors</i> 32 Rutland Square Edinburgh EH1 2BW Tel: +44(0)131 229 7351 Fax: +44(0)131 228 4523 Email: valuations@davidadamsongroup.com
--------------------	---

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

Unless otherwise stated within this report, all parts of the Property are subject to a visual inspection from within the property without the need to move any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right are taken facing the front of the property.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items, floor coverings and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. were not inspected or reported on.

Description	Purpose built, ex Local Authority, main door flat in a two storey block of four.
Accommodation	Lounge, 2 bedrooms, kitchen, shower room and hall.
Gross internal floor area (m²)	55 sq m or thereby.
Neighbourhood and location	The Property is situated to a compatible residential location within close proximity to local amenities and services.
Age	Constructed circa 1930.
Weather	Dry but overcast.
Chimney stacks	Masonry rendered.

Roofing including roof space	Timber pitched, slate cover. No access to common roof space. Common landing hatch locked at time of inspection.
Rainwater fittings	Cast iron.
Main walls	Cavity masonry with roughcast finish.
Windows, external doors and joinery	PVC double glazed windows. Timber, glazed threshold doors.
External decorations	Painterwork and render finishes.
Conservatories / porches	Not applicable.
Communal areas	Shared path to rear drying green.
Garages and permanent outbuildings	Not applicable.
Outside areas and boundaries	Private front and rear gardens. Communal rear drying green. Metal railing to the rear. Timber fencing.
Ceilings	Plaster. Some textured finishes.
Internal walls	Predominantly solid partitions. Plaster finishes.
Floors including sub floors	Suspended timber. Not visible due to fitted floor coverings. Sub floor areas were not open to inspection.
Internal joinery and kitchen fittings	Reasonably modern kitchen fittings (appliances not tested). Timber panel and glazed doors.

Chimney breasts and fireplaces

Gas fire with back boiler to lounge fireplace. The flue has not been inspected.

Internal decorations

Painterwork and wallpaper

Cellars

Not Applicable.

Electricity

13 AMP. Mains supply. Re-wireable fusebox.

Gas

Mains supply.

Water, plumbing and bathroom fittings

Older style shower room fittings. Visible internal water distribution was copper and plastic. Plastic cold water tank.

Heating and hot water

A gas fired back boiler to the lounge fireplace provides hot water and serves a wet radiator system. Insulated hot water tank with electric immersion heater.

Drainage

Mains sewer


Fire, smoke and burglar alarms

Systems not tested.

Any additional limits to inspection:

The Property was occupied, fully furnished and with all floors fully covered. Sub floor areas were not open to inspection. External parts were inspected from ground level. Common roof space not inspected. The main services and appliances were not tested. Underground drainage and manholes were not inspected.

Sectional diagram showing elements of a typical house

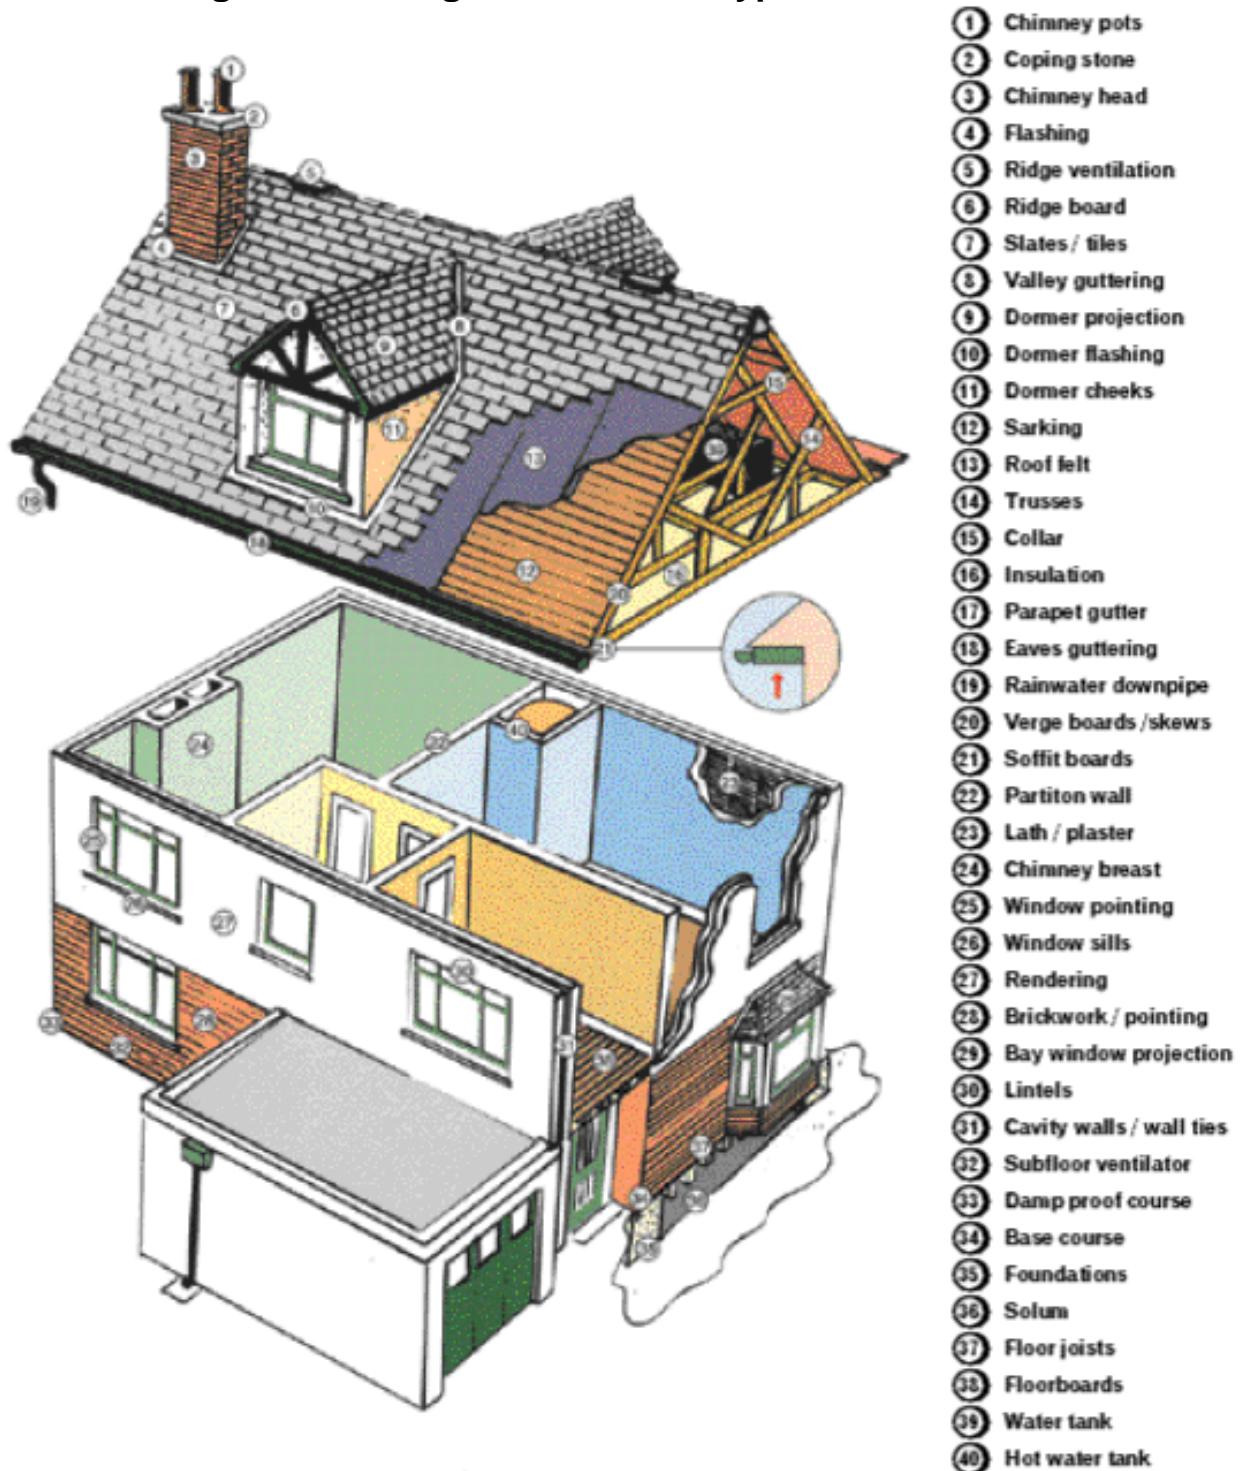






Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these terms.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of three categories.

Category 3	Category 2	Category 1
Urgent Repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

	Structural movement	
Repair category	1	
Notes:	Longstanding settlement noted (cracking to render finish). No evidence of undue recent or progressive movement.	
	Dampness, rot and infestation	
Repair category	1	
Notes:		
	Chimney stacks	
Repair category:	1	
Notes:	Ongoing common maintenance is to be expected to render finish.	
	Roofing including roof space	
Repair category:	2	
Notes:	Some cracked slates noted. Ongoing common maintenance is to be expected. Entrance canopy requires repair.	
	Rainwater fittings	
Repair category:	1	
Notes:	Usual maintenance and cleaning is to be expected.	

single survey



Main walls

Repair category:

2

Notes:

Localised repair required to cracked render.



Windows, external doors and joinery

Repair category:

1

Notes:



External decorations

Repair category:

1

Notes:

Decoration: average.



Conservatories / porches

Repair category:

N/A

Notes:



Communal areas

Repair category:

1

Notes:



Garages and permanent outbuildings

Repair category:

N/A

Notes:



Outside areas and boundaries

Repair category:

1

Notes:



Ceilings

Repair category:	1
Notes:	Textured finishes may contain asbestos. If left undisturbed, this material does not represent a hazard or risk. Should removal be required at a future date, specialist consultation is advised.



Internal walls

Repair category:	2
Notes:	Localised skimming required to plaster finish in shower room.



Floors including sub-floors

Repair category:	1
Notes:	



Internal joinery and kitchen fittings

Repair category:	1
Notes:	It should be verified that glazed doors have been fitted with safety glass.



Chimney breasts and fireplaces

Repair category:	1
Notes:	Gas fire not tested. The Seller should confirm that the appliance is fully functional and regularly serviced. Installation of a flue liner may be required.



Internal decorations

Repair category:	1
Notes:	Decoration: average.



Cellars

Repair category: N/A

Notes:



Electricity

Repair category: 2

Notes: The electrical provision is of an older type and some upgrade shall be likely to comply with present electrical regulations.



Gas

Repair category: 1

Notes:



Water, plumbing and bathroom fittings

Repair category: 1

Notes: Shower room fittings are adequate. Consideration may be given to renewal of fittings within the not too distant future.



Heating and hot water

Repair category: 1

Notes: The central heating back boiler to the lounge fireplace could not be inspected. The Seller stated that the appliance is regularly serviced and maintained. Inspection of the most recent certificates is advised. Upgrading is to be expected shortly.



Drainage

Repair category: 1

Notes: Systems not tested. Underground drainage and manholes not inspected.

single survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	1
External decorations	1
Conservatories / porches	N/A
Communal areas	1
Garages and permanent outbuildings	N/A
Outside areas and boundaries	1
Ceilings	1
Internal walls	2
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	N/A
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3:

Urgent Repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2:

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1:

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes: Parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Replacement double glazed windows have been installed.

Usual Scottish Legal enquiries should be made.

Estimated re-instatement cost for insurance purposes

£116,000 (ONE HUNDRED AND SIXTEEN THOUSAND POUNDS)

Valuation and market comments

The Market Value of the subjects can be fairly expressed as a sum in the region of £125,000 (ONE HUNDRED AND TWENTY FIVE THOUSAND POUNDS).

The Property is considered suitable for Mortgage Lending Purposes.

The Market Value expressed herein is effective as at the date of valuation. Seller and Buyer are advised that market value may rise or fall as market conditions change. Should parties relying on this report and valuation consider market conditions may have changed materially from the date of this valuation, a revaluation should be instructed.

Report author: Greig Miller MRICS

Address: 32 Rutland Square, Edinburgh, EH1 2BW

Signed:



Date of report: 2nd August 2011

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

1

Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey.

It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid.

Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

1.10 DEFINITIONS

- the “Lender” is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the “Transcript Mortgage Valuation Report for Lending Purposes” means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the “Market Value” is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm’s-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the “Property” is the property which forms the subject of the Report;
- the “Purchaser” is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the “Report” is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the “Seller” is/are the proprietor(s) of the Property;
- the “Surveyor” is the author of the Report on the Property; and
- the “Surveyors” are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the “Surveyors” means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a re-inspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

Address of dwelling and other details

63 WHITSON ROAD
EDINBURGH
EH11 3BU

Dwelling type: Ground-floor flat
Name of approved organisation: Elmhurst Energy Systems Ltd
Membership number: EES/008302
Date of certificate: 08 August 2011
Reference number: 0387-1017-1208-4479-3904
Type of assessment: RdSAP, existing dwelling
Total floor area: 55 m²
Main type of heating and fuel: Boiler and radiators, mains gas

This dwelling's performance ratings

This dwelling has been assessed using the RdSAP 2009 methodology. Its performance is rated in terms of the energy use per square metre of floor area, energy efficiency based on fuel costs and environmental impact based on carbon dioxide (CO₂) emissions. CO₂ is a greenhouse gas that contributes to climate change.

Energy Efficiency Rating

	Current	Potential
<i>Very energy efficient - lower running costs</i>		
(92 plus) A		
(81-91) B		
(69-80) C		
(55-68) D	59	69
(39-54) E		
(21-38) F		
(1-20) G		
<i>Not energy efficient - higher running costs</i>		
Scotland	EU Directive 2002/91/EC	

The energy efficiency rating is a measure of the overall efficiency of a home. The higher the rating the more energy efficient the home is and the lower the fuel bills are likely to be.

Approximate current energy use per square metre of floor area: 305 kWh/m²per year

Approximate current CO₂emissions: 59 kg/m²per year

Environmental Impact (CO₂) Rating

	Current	Potential
<i>Very environmentally friendly - lower CO₂emissions</i>		
(92 plus) A		
(81-91) B		
(69-80) C		
(55-68) D	57	69
(39-54) E		
(21-38) F		
(1-20) G		
<i>Not environmentally friendly - higher CO₂emissions</i>		
Scotland	EU Directive 2002/91/EC	

The environmental impact rating is a measure of a home's impact on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating the less impact it has on the environment.

Cost effective improvements

Below is a list of lower cost measures that will raise the energy performance of the dwelling to the potential indicated in the tables above. Higher cost measures could also be considered and these are recommended in the attached energy report.

- | | |
|---|---------------------------------|
| 1 Cavity wall insulation | 3 Hot water cylinder thermostat |
| 2 Low energy lighting for all fixed outlets | |

A full energy report is appended to this certificate



Remember to look for the Energy Saving Trust Recommended logo when buying energy-efficient products. It's a quick and easy way to identify the most energy-efficient products on the market.

Information from this EPC may be given to the Energy Saving Trust to provide advice to householders on financial help available to improve home energy efficiency.

Energy Report



The Energy Performance Certificate and Energy Report for this dwelling were produced following an energy assessment undertaken by a member of Elmhurst Energy Systems Ltd. This is an organisation which has been approved by the Scottish Ministers. The certificate has been produced under the Building (Scotland) Amendment Regulations 2006 and a copy of the certificate and this energy report have been lodged on a national register.

Assessor's name: Mr. Greig David Miller
Company name/trading name: David Adamson & Partners
Address: 32 Rutland Square Edinburgh EH1 2BW
Phone number: 0131 229 7351
Fax number: 0131 228 4523
E-mail address: gdm@davidadamsongroup.com
Related party disclosure: No related party

Estimated energy use, carbon dioxide (CO₂) emissions and fuel costs of this home

	Current	Potential
Energy use	305 kWh/m ² per year	218 kWh/m ² per year
Carbon dioxide emissions	3.2 tonnes per year	2.3 tonnes per year
Lighting	£59 per year	£32 per year
Heating	£426 per year	£347 per year
Hot water	£203 per year	£141 per year

The figures in the table above have been provided to enable prospective buyers and tenants to compare the fuel costs and carbon emissions of one home with another. To enable this comparison the figures have been calculated using standardised running conditions (heating periods, room temperatures, etc.) that are the same for all homes, consequently they are unlikely to match an occupier's actual fuel bills and carbon emissions in practice. The figures do not include the impacts of the fuels used for cooking or running appliances, such as TV, fridge etc.; nor do they reflect the costs associated with service, maintenance or safety inspections. Always check the certificate date because fuel prices can change over time and energy saving recommendations will evolve.

About the building's performance ratings

The ratings on the certificate provide a measure of the buildings overall energy efficiency and its environmental impact, calculated in accordance with a national methodology that takes into account factors such as insulation, heating and hot water systems, ventilation and fuels used.

Not all buildings are used in the same way, so energy ratings use standard occupancy assumptions which may be different from the specific way you use your home.

Buildings that are more energy efficient use less energy, save money and help protect the environment. A building with a rating of 100 would cost almost nothing to heat and light and would cause almost no carbon emissions. The potential ratings in the certificate describe how close this building could get to 100 if all the cost effective recommended improvements were implemented.

About the impact of buildings on the environment

One of the biggest contributors to global warming is carbon dioxide. The way we use energy in buildings causes emissions of carbon. The energy we use for heating, lighting and power in homes produces over a quarter of the UK's carbon dioxide emissions and other buildings produce a further one-sixth.

The average household causes about 6 tonnes of carbon dioxide every year. Adopting the recommendations in this report can reduce emissions and protect the environment. You could reduce emissions even more by switching to renewable energy sources. In addition there are many simple everyday measures that will save money, improve comfort and reduce the impact on the environment. Some examples are given at the end of this report.

Summary of this home's energy performance related features

The table below gives an assessment of the key individual elements that have an impact on this home's energy and environmental performance. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the physical condition of any element. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology based on age and type of construction

Element	Description	Current performance	
		Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	★ ★ ☆ ☆ ☆	★ ★ ☆ ☆ ☆
Roof	(another dwelling above)	—	—
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★ ★ ★ ☆ ☆	★ ★ ★ ☆ ☆
Main heating	Boiler and radiators, mains gas	★ ★ ★ ★ ☆	★ ★ ★ ★ ☆
Main heating controls	Programmer, room thermostat and TRVs	★ ★ ★ ★ ☆	★ ★ ★ ★ ☆
Secondary heating	Room heaters, mains gas	—	—
Hot water	From main system, no cylinder thermostat	★ ★ ☆ ☆ ☆	★ ★ ☆ ☆ ☆
Lighting	Low energy lighting in 17% of fixed outlets	★ ★ ☆ ☆ ☆	★ ★ ☆ ☆ ☆

Current energy efficiency rating

D 59

Current environmental impact (CO₂) rating

D 57

Low and zero carbon energy sources

These are sources of energy (producing or providing electricity or hot water) which emit little or no carbon dioxide into the atmosphere. There are none applicable to this home.

Renewable Heat Incentive

You could receive 20 years of RHI payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated to 150 mm and cavity walls filled. The energy required for space and water heating shown below would form the basis of the payments. The Department of Energy and Climate Change has up-to date information on technologies supported and the support levels at www.decc.gov.uk/rhi.

This dwelling: Loft insulation not applicable, Cavity walls not insulated

Heat demand for RHI	Existing dwelling	With loft insulation only	With cavity insulation only	With loft and cavity insulation
Space heating (kWh per year)	6,033	-	4,452	-
Water heating (kWh per year)	3,285			

Recommended measures to improve this homes energy performance

The measures below are cost effective. The performance ratings after improvement listed below are cumulative, that is they assume the improvements have been installed in the order that they appear in the table. However you should check the conditions in any covenants, warranties or sale contracts, and whether any legal permissions are required such as a building warrant, planning consent or listed building restrictions. The indicative costs are representative for most properties but may not apply in a particular case.

Lower cost measures	Indicative Cost	Typical savings per year	Ratings after improvement	
			Energy Efficiency	Environmental Impact
1 Cavity wall insulation	£100 - £300	£79	D 63	D 63
2 Low energy lighting for all fixed outlets	£13	£22	D 65	D 64
3 Hot water cylinder thermostat	£200 - £400	£66	C 69	C 69
Sub-Total		£167		
Higher cost measures				
4 Replace boiler with new condensing boiler	£1,500 - £3,500	£81	C 73	C 76
Total		£248		
Potential energy efficiency rating			C 73	
Potential environmental impact (CO ₂) rating			C 76	

Further measures to achieve even higher standards

None

About the cost effective measures to improve this home's performance ratings

If you are a tenant, before undertaking any work you should check the terms of your lease and obtain approval from your landlord if the lease either requires it, or makes no express provision for such work.

Lower cost measures

These measures are relatively inexpensive to install and are worth tackling first. The indicative costs of measures included earlier in this EPC include the costs of professional installation in most cases. Some of them may be installed as DIY projects. DIY is not always straightforward, and sometimes there are health and safety risks, so take advice before carrying out DIY improvements.

1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Low energy lighting

Replacement of traditional light bulbs with energy saving recommended ones will reduce lighting costs over the lifetime of the bulb, and they last up to 12 times longer than ordinary light bulbs. Also consider selecting low energy light fittings when redecorating; contact the Lighting Association for your nearest stockist of Domestic Energy Efficient Lighting Scheme fittings.

3 Cylinder thermostat

A hot water cylinder thermostat enables the boiler to switch off when the water in the cylinder reaches the required temperature; this minimises the amount of energy that is used and lowers fuel bills. The thermostat is a temperature sensor that sends a signal to the boiler when the required temperature is reached. To be fully effective it needs to be sited in the correct position and hard wired in place, so it should be installed by a competent plumber or heating engineer. It should be noted that building standards may apply to this work.

About the further measures to achieve even higher standards

Not applicable

What can I do today?

Actions that will save money and reduce the impact of your home on the environment include:

- Ensure that you understand the dwelling and how its energy systems are intended to work so as to obtain the maximum benefit in terms of reducing energy use and CO₂ emissions.
- If you have a conservatory or sunroom, avoid heating it in order to use it in cold weather and close doors between the conservatory and dwelling.
- Check that your heating system thermostat is not set too high (in a home, 21°C in the living room is suggested) and use the timer to ensure you only heat the building when necessary.
- Make sure your hot water is not too hot - a cylinder thermostat need not normally be higher than 60°C
- Turn off lights when not needed and do not leave appliances on standby. Remember not to leave chargers (e.g. for mobile phones) turned on when you are not using them.
- Close your curtains at night to reduce heat escaping through the windows.
- If you're not filling up the washing machine, tumble dryer or dishwasher, use the half-load or economy programme. Minimise the use of tumble dryers and dry clothes outdoors where possible.
- Check the draught-proofing of windows and replace it if appropriate.
- If you have unused open chimneys consider blocking them off (making provision for a ventilation opening and a cowl on top of the chimney to avoid dampness).

For advice on how to take action and to find out about offers available to help make your home more energy efficient, call 0800 512 012 or visit www.energysavingtrust.org.uk.

Our Ref: 9316/GDM/IAM

2nd August 2011

Mrs L MacDonald
63 Whitson Road
Edinburgh
EH11 3BU



Dear Madam,

PROPERTY: 63 WHITSON ROAD, EDINBURGH, EH11 3BU

Pursuant to instructions received we inspected the aforementioned property on 1st August 2011, for the purpose of determining the Market Value of Heritages with Vacant Possession under the terms of a Scheme 1/Mortgage Valuation only. We report as follows:

REPORT AND VALUATION

Valuation Statement: (Market Value)	£125,000 (ONE HUNDRED AND TWENTY FIVE THOUSAND POUNDS).
--	---

Reinstatement Insurance: (Day One Basis)	£116,000 (ONE HUNDRED AND SIXTEEN THOUSAND POUNDS).
---	---

General Comments :	<p>The property is considered to be suitable security for Mortgage Purposes.</p> <p>The property was occupied and fully furnished at the time of inspection with all floors covered. The level of inspection was consequently restricted. Sub-floor areas and roof voids not inspected. Services and appliances not tested.</p> <p>The general condition of the property appears consistent with its age and type of construction, but some works of repair and maintenance are required. Elements of the property are ageing and likely to require attention/renewal.</p> <p><u>Alterations (See Note 2):</u> Replacement double glazing.</p>
--------------------	---

SUBJECTS: 63 WHITSON ROAD, EDINBURGH, EH11 3BU

Description:	Purpose built, Ex Local Authority, main door flat constructed circa 1930. Private garden to the front and rear. Shared rear drying green.
Location:	Compatible residential.
Construction:	Roof – Pitched with slate cover. Walls – Cavity masonry with roughcast finish. Floors - Suspended timber.
Accommodation:	Lounge, 2 bedrooms, kitchen, shower room and hall.
Mains Services and Heating:	Gas <input checked="" type="checkbox"/> Elec. <input checked="" type="checkbox"/> Water <input checked="" type="checkbox"/> Drain <input checked="" type="checkbox"/> GFCH <input checked="" type="checkbox"/> Other Heating <input type="checkbox"/>
Condition:	Average. Would benefit from some internal upgrading to services.
Essential Repairs:	None.

We trust the foregoing satisfies your requirements, however if we can be of any further assistance, please do not hesitate to contact this office.

Yours faithfully



Greig Miller, MRICS
For and on behalf of
DAVID ADAMSON & PARTNERS Ltd

SUBJECTS: 63 WHITSON ROAD, EDINBURGH, EH11 3BU

NOTES:

- (1) Major Alterations; all Building Warrants and Permissions must be in order (to be verified by the Clients Solicitor).
- (2) Significant Alterations; not considered material for Lending Authority purposes. Clients Solicitor to consider further for the Clients own purposes.
- (3) Detailed Specialist/Contractor inspection and reporting of the dwelling is recommended for Lending purposes and prior to the bargain being concluded.
- (4) Detailed Specialist/Contractor inspection and reporting of the dwelling is not required for Lending Purposes but it is advised that the Client obtain such reporting prior to the bargain being concluded.

Description of the MORTGAGE VALUATION REPORT

- 1.0 The Mortgage Valuation Report
The valuation for mortgage purposes is a limited report for building societies, banks and other lenders before a loan is made on a property.
- This is not a survey.
 - The report is used to guide lenders on the value of a property for loan purposes only.
- 2.0 The Inspection
- 2.1 The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Valuer. So furniture, floor coverings and other contents are not moved or lifted; and no part is forced or laid open to make it accessible.
- 2.2 Subject to reasonable accessibility, the roof space is inspected only to the extent visible from the access hatch, without entering it. Communal roof spaces, under-floor areas and other parts not readily accessible are not inspected. The exterior and roof of the property will be inspected from ground level only.
- 2.3 The Valuer will identify whether or not there are gas, electricity, central heating, plumbing and drainage services. Testing of services is not undertaken. For all forms of gas, oil, LPG and solid fuel central and space heating systems (including heating systems which also provide hot water) we recommend you appoint a CORGI registered Heating Engineer to inspect, test and report on same within the Sellers Missives Indemnity Period.
- 3.0 The Report
- 3.1 Although the inspection will be carried out by a Valuer who will usually be a qualified Surveyor, it is not a detailed inspection of the property, and only major visible defects will be noted.
But remember! A mortgage valuation is based on a restricted inspection to meet the requirements of lending institutions. It is not a survey.
- 3.2 Where major defects are noted we may recommend further investigations or advice which you should action before committing to purchasing the property.
- 3.3 We may also recommend part of the mortgage be retained by the lenders until repair works are carried out and figures may be suggested subject to reports and quotations.
- 4.0 The Valuation and Reinstatement Cost
- 4.1 The Report contains our opinion on both of the Market Value of the Property and of the Reinstatement Cost, as defined below.
- 4.2 "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.

In arriving at the opinion of the Market Value, we will make various standard assumptions. For example:

- vacant possession will be provided;
- tenure will be feuhold;
- that all required, valid planning permissions and statutory approvals for the buildings and for their use, including any extensions or alterations, have been obtained and complied with;
- the property is not subject to any unusual or especially onerous restrictions, encumbrances or outgoing and that good title can be shown;
- that no deleterious or hazardous materials or techniques have been used, that there is no contamination in or from the ground, and it is not landfilled ground;
- the property and its value are unaffected by any matters which would be revealed by a Local Search or by a Statutory Notice and that the property use is lawful;
- for new property the valuation assumes successful completion and that the builder is a registered member of the NHBC or Zurich Municipal Mutual.

In the case of flats, the following further assumptions are made that:

- there are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas and other facilities;
- there are no particularly troublesome or unusual legal restrictions;
- there is no current dispute between the occupiers of the flats, or any outstanding claims or lawsuits; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

- 4.3 RICS Day One 'Reinstatement Cost' is an estimate for insurance purposes of the total cost of rebuilding all buildings and site works as new-build at the date of assessment, retaining the properties existing form and materials; insofar as the design, specification and materials would require to change in order to comply with Building Standards and statutory requirements current at the date of assessment. This includes the cost of rebuilding the garage, boundary/retaining wall and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on fees).
- 4.4. Our report is private and confidential to you in the context supplied and no responsibility is accepted to any third party (whether notified to us or not) for the whole nor any part of its content. However, in line with local Scottish practice we reserve the right to make the report available to other parties and, if requested, to their lending institutions.

A FULL COPY OF THE SPECIFICATION FOR RESIDENTIAL MORTGAGE VALUATION IS AVAILABLE FROM THIS OFFICE ON REQUEST.

property questionnaire

Property address	63 WHITSON ROAD EDINBURGH EH11 3BU
Seller(s)	
Completion date of property questionnaire	25 / 7 / 11

property questionnaire

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property?	22 YRS.
2.	Council tax	
	Which Council Tax band is your property in? (Please circle)	
	A B C D E F G H	
3.	Parking	
	What are the arrangements for parking at your property?	
	(Please tick all that apply)	
	• Garage	<input type="checkbox"/>
	• Allocated parking space	<input type="checkbox"/>
	• Driveway	<input type="checkbox"/>
	• Shared parking	<input type="checkbox"/>
	• On street	<input checked="" type="checkbox"/>
	• Resident permit	<input type="checkbox"/>
	• Metered parking	<input type="checkbox"/>
	• Other (please specify):	<input style="width: 100%;" type="text"/>
4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes/No/ Don't know

property questionnaire

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	Yes/No
6.	Alterations/additions/extensions	
a.	<p>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</p> <p>If you have answered yes, please describe below the changes which you have made:</p>	Yes/No
	<p>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p>If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</p>	Yes/No
b.	<p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p>If you have answered yes, please answer the three questions below:</p>	Yes/No
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes/No
	(ii) Did this work involve any changes to the window or door openings?	Yes/No
	<p>(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):</p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p>	

property questionnaire

7.	Central heating	
a.	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).</p> <p><u>If you have answered yes or partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	Yes/No/ <u>Partial</u>
	i) When was your central heating system or partial central heating system installed?	1988
	<p>(ii) Do you have a maintenance contract for the central heating system? <u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:</p> <p style="text-align: center;">SCOTTISH GAS</p>	<u>Yes</u> /No
	<p>(iii) When was your maintenance agreement last renewed? (Please provide the month and year).</p> <p style="text-align: right;">RENEWED ANNUALLY</p>	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes/ <u>No</u>
9.	Issues that may have affected your property	
a.	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p>	Yes/ <u>No</u> Yes/No
b.	<p>Are you aware of the existence of asbestos in your property?</p> <p><u>If you have answered yes</u>, please give details:</p>	Yes/ <u>No</u>

property questionnaire

10. Services

a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas or liquid petroleum gas	✓	BRITISH GAS
Water mains or private water supply	✓	SCOTTISH WATER
Electricity	✓	BRITISH GAS
Mains drainage *	✓	SCOTTISH WATER
Telephone *	✓	TALK TALK
Cable TV or satellite *		
Broadband	✓	TALK TALK

b. Is there a septic tank system at your property?

Yes/No

If you have answered yes, please answer the two questions below:

(i) Do you have appropriate consents for the discharge from your septic tank?

Yes/No/
Don't know

(ii) Do you have a maintenance contract for your septic tank?

Yes/No

If you have answered yes, please give details of the company with which you have a maintenance contract:

property questionnaire

11. Responsibilities for shared or common areas		
a.	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes, please give details:</u></p>	Yes/No/ Don't know
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes, please give details:</u></p> <p>ROOF, R NONES ETC. X 8</p>	Yes/No/ Not applicable
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	Yes/No
d.	<p>Do you have the right to walk over any of your neighbours' property – for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p> <p>BINS, WINDOW CLEANING ETC.</p>	Yes/No
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p> <p>WINDOW CLEANING ETC.</p>	Yes/No
f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p>	Yes/No
12. Charges associated with your property		
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</u></p>	Yes/No

property questionnaire

b.	<p>Is there a common buildings insurance policy?</p> <p><u>If you have answered yes</u>, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<p>Yes/No/ Don't know</p> <p>Yes/No/ Don't know</p>
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
<p>13. Specialist works</p>		
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</p>	<p>Yes/No</p>
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please give details:</p>	<p>Yes/No</p>
c.	<p><u>If you have answered yes</u> to 13(a) or (b), do you have any guarantees relating to this work?</p> <p><u>If you have answered yes</u>, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	<p>Yes/No</p>

property questionnaire

14.	Guarantees					
a.	Are there any guarantees or warranties for any of the following:					
(i)	Electrical work	No	Yes	Don't know	With title deeds	Lost
(ii)	Roofing	No	Yes	Don't know	With title deeds	Lost
(iii)	Central heating	No	Yes	Don't know	With title deeds	Lost
(iv)	National House Building Council (NHBC)	No	Yes	Don't know	With title deeds	Lost
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title deeds	Lost
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):					
c.	Are there any outstanding claims under any of the guarantees listed above?					Yes/No
	<u>If you have answered yes, please give details:</u>					
15.	Boundaries					
	So far as you are aware, has any boundary of your property been moved in the last 10 years?					Yes/No/Don't know
	<u>If you have answered yes, please give details:</u>					

property questionnaire

16.	Notices that affect your property	
In the past three years have you ever received a notice:		
a.	advising that the owner of a neighbouring property has made a planning application?	Yes/No
b.	that affects your property in some other way?	Yes/No
c.	that requires you to do any maintenance, repairs or improvements to your property?	Yes/No
If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.		

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): Lorna MacDonald

Date: 21/7/11